

Dustin,

Sorry that I didn't see this earlier. I'm typically out in the shop and just hop on the forums when I get a chance.

The [gasket](#) on the front of the housing (3 bolt) is part number MD329503. If it's not too severely damaged/worn, you could always try a *THIN* coat of RTV to patch it in the meanwhile.

You already have the other seal for the CAS itself (MD622021), so the only other seal is on the back side where it seals to the head. If you're getting leakage out of the front cover, I would probably not only fix the 3-bolt cover gasket, but reseal the RTV on the rear where it sits against the head.

I grabbed a used one that was sitting back in the parts bin (please excuse the child-like use of [Paint](#)). You can see in the 2nd picture (arrow) where the groove is that you need to RTV.

Make sure that you [clean](#) off both surfaces (head and CAS) to remove the old RTV and oil.

You should be oil-free after that.

Josh



